Mountain Visual Site Inspection					on R	ерс	ort					
Project Name H-600 Pipeline Spread H			AFE			124300138		Spi	oread H-600 Pipeline Spread H		oread H	
Contractor Precision						Repo	port # 4847					
Inspect	or Glenn Mike	e Renfro						Date/1	Гіте	7/19/2018	3:2	I PM
Permit # TBD			Inspection	Inspection Type VA SWPP				Station Begin 13415+00				
State	VA		Inspection Area		Full Sta		Stati	tion End 13670+00		+00		
County Franklin		Ground		Dry			Temperature (°F)			84.00		
Municipality	Municipality N/A			Weather		Sunny		Rain Gauge (in)			0.00	
GPS Location	36.971757652	0756, -79.869	9956385443				Rain Ad	n Accumulation Time (days)			/s)	1.00
1. Are the appro	oved (stampe	d) E&S Plan	and PCSM Pla	PCSM Plan present on site?				, , ,			Yes	
2. Are there act (If yes, notify3. Is Constructi	the MVP Env	rironmental P	ermitting Coo	dinato	r and ex	pla	ain in con	nments.))			No
	No, notify MV	P Environme	ntal Permittinឲ្	g Coor	dinator a	and	l explain	in comm	nents.)	1		Yes a picture
E	&S BMPs	C	compliance Level		Corrective Action					rective Frame	R	Date epaired
Compost Filter So	ock	Acc	eptable									
Housekeeping		Acc	eptable									
Rock Construction Entrance		Acc	eptable									
Silt Fence (Filter I	Fabric Fence)	Acc	eptable									
Temporary Divers	sion Berm	Acc	eptable									
Silt Fence (Reinfo	orced Filter Fab	ric Fence) Acc	eptable									
5. Site Conditi	ons											
Is an unauthoriz beyond defined a photo and imn	limits of distur	bance resulti	ng from earth	disturl	oance ad	ctiv	rity or ine	-				No
Have inactive disturbed areas (stockpiles, final grade) been stabilized per state requirements?								Yes				
Are slopes 3:1 and greater stabilized with appropriate BMPs as per E&S plans?								No				
Has a new slip/slide been observed? (If yes, complete Slide Report Form)								No				

MVP-34 REV 0 Page 1 of 3

AFE 124300138	Date/Tir	ne 7/19/2018 3:21 PM	Report # 484	17				
6. PCSM BMPs (List BMPs and note if installed and maintained as per the plan. If corrective action is needed, a picture is required.)								
PCSM BMPs	Compliance Level	Corrective Action	Corrective Time Frame	Date Repaired				
				-				
7. Identify all remedial measures that h	ave been taken s	since the previous inspection was	s conducted.					
Comments (Reference above questions								
Preformed SWPPP inspection of Spread H from 13415+00 to 13670+00. All perimeter ECD's were inspected and found to be in good condition. Stream(S-IJ4) was open cut, lowered in, backfilled and immediately stabilized. All RCE's were clean and roads were clear of any debris. All waterbars were found to be built to specifications. This section is currently in compliance.								
Note: It is a condition of National Polluta maintenance program be conducted to								
weekly basis and after each stormwater event. Please list in the space provided comments to note if repairs or replacement are needed or have been made for BMPs as a result of the inspection. Failure to conduct the required								

MVP-34 REV 0 Page 2 of 3

inspection may result in permit suspension or the imposition of civil penalties. If supplemental monitoring is required

as part of a permit condition this form may be used to meet those monitoring requirements.

AFE 124300138	8	Date/Time	7/19/2018 3:21 PI	M Report # 4	847		
Pictures							
GPS Location	36.9717623423024, -79.8700013	370226	GPS Location	36.9717620218045, -79.87000			
Description	Stream crossing S-IJ4		Description	Lowered in pipe GAS S-IJ4			
	36.9717625364521, -79.870001129545		GPS Location	36.9717625383416, -79.87000)11304641		
Description	Lowering in and backfill operation	าร	Description	Stream S-IJ4			
	Insert image here			Insert image here			
GPS Location			GPS Location				
Description			Description				

MVP-34 REV 0 Page 3 of 3