Baseline Assessment – Stream Attributes

Reach S-YZ5 (Pipeline ROW) Ephemeral Spread I Franklin County, Virginia

Data	Included
Photos	✓
SWVM Form	✓
FCI Calculator and HGM Form	✓
RBP Physical Characteristics Form	✓
Water Quality Data	N/A – No flow
RBP Habitat Form	✓
RBP Benthic Form	✓
Benthic Identification Sheet	N/A lack of habitat
Wolman Pebble Count	✓
RiverMorph Data Sheet	✓
USM Form (Virginia Only)	✓
Longitudinal Profile and Cross Sections	✓

Spread I Stream S-YZ5 (Pipeline ROW) Franklin County



Location, Orientation, Photographer Initials: Downstream at ROW/LOD looking E upstream, VM



Photo Type: DS COND

Location, Orientation, Photographer Initials: Downstream at ROW/LOD looking SW downstream, VM

Spread I Stream S-YZ5 (Pipeline ROW) Franklin County



Photo Type: LB CL

Location, Orientation, Photographer Initials: On thalweg at pipe centerline looking SE at right streambank, VM



Photo Type: RB CL

Location, Orientation, Photographer Initials: On thalweg at pipe centerline looking N at left streambank, VM

Spread I Stream S-YZ5 (Pipeline ROW) Franklin County



Photo Type: US COND Location, Orientation, Photographer Initials: Upstream at ROW/LOD looking NE upstream, VM



Location, Orientation, Photographer Initials: Upstream at ROW/LOD looking NW downstream, VM

USACE FILE NO./ Project Name: (v2.1, Sept 2015)		Mountain	n Valley Pipeline	IMPACT COORDINATES: (in Decimal Degrees)	Lat.	37.063464	Lon.	-79.878281	WEATHER:		Sunny	DATE:	8/28/2021
IMPACT STREAM/SITE ID ANI (watershed size (acreage), unal		FION:	S-YZ5; 2	.9 Acres		MITIGATION STREAM CLASS. (watershed size {acreag						Comments:	
STREAM IMPACT LENGTH:	86 M	FORM OF MITIGATION:	RESTORATION (Levels I-III)	MIT COORDINATES: (in Decimal Degrees)	Lat.		Lon.		PRECIPITATION PAST 48 HRS:		No	Mitigation Length:	
Column No. 1- Impact Existing Co	ondition (Debit)		Column No. 2- Mitigation Existing Co	ndition - Baseline (Credit)		Column No. 3- Mitigation P Post Completio		e Years	Column No. 4- Mitigation Pro Post Completion		ears	Column No. 5- Mitigation Projecte	d at Maturity (Credit)
Stream Classification:	Ephemeral		Stream Classification:			Stream Classification:		0	Stream Classification:	(0	Stream Classification:	0
Percent Stream Channel Slope		0.05	Percent Stream Channel Slo	pe e		Percent Stream Channel S	lope	0	Percent Stream Channel S	lope	0	Percent Stream Channel Slo	ope 0
HGM Score (attach data f	forms):		HGM Score (attach d	ata forms):		HGM Score (attach	h data forms):		HGM Score (attach o	data forms):		HGM Score (attach da	ta forms):
	Ave	erage		Average				Average			Average		Average
Hydrology	0.31		Hydrology			Hydrology			Hydrology			Hydrology	
Biogeochemical Cycling		333333	Biogeochemical Cycling	0		Biogeochemical Cycling		0	Biogeochemical Cycling		0	Biogeochemical Cycling	0
PART I - Physical, Chemical and Biol	0.24 logical Indicators		Habitat PART I - Physical, Chemical and	Biological Indicators		Habitat PART I - Physical, Chemical a	and Biological I	ndicators	Habitat PART I - Physical, Chemical and	d Biological Indic	cators	Habitat PART I - Physical, Chemical and	Biological Indicators
Poin	nts Scale Range Site	Score		Points Scale Range Site Score			Points Scale Range	ge Site Score		Points Scale Range	Site Score		Points Scale Range Site Score
PHYSICAL INDICATOR (Applies to all streams class	ssifications)		PHYSICAL INDICATOR (Applies to all streams of	lassifications)		PHYSICAL INDICATOR (Applies to all stream	ns classifications)	•	PHYSICAL INDICATOR (Applies to all stream	ns classifications)		PHYSICAL INDICATOR (Applies to all streams	classifications)
USEPA RBP (High Gradient Data Sheet)			USEPA RBP (Low Gradient Data Sheet)			USEPA RBP (High Gradient Data Sheet)			USEPA RBP (High Gradient Data Sheet)			USEPA RBP (High Gradient Data Sheet)	
-		0	Epifaunal Substrate/Available Cover	0-20		Epifaunal Substrate/Available Cover	0-20		Epifaunal Substrate/Available Cover	0-20		Epifaunal Substrate/Available Cover	0-20
		11	Pool Substrate Characterization	0-20		2. Embeddedness	0-20		2. Embeddedness	0-20		2. Embeddedness	0-20
		0 16	Pool Variability Sediment Deposition	0-20 0-20		Velocity/ Depth Regime Sediment Deposition	0-20 0-20		Velocity/ Depth Regime Sediment Deposition	0-20 0-20		Velocity/ Depth Regime Sediment Deposition	0-20 0-20
		0	5. Channel Flow Status	0-20		Channel Flow Status	0-20		5. Channel Flow Status	0-20		Sediment Deposition Channel Flow Status	0-20
-	0-1	10	6. Channel Alteration	0-20 0-1		6. Channel Alteration	0-20 0-		6. Channel Alteration	0-20 0-1		6. Channel Alteration	0-20 0-1
1		0	7. Channel Sinuosity	0-20		7. Frequency of Riffles (or bends)	0-20		7. Frequency of Riffles (or bends)	0-20		7. Frequency of Riffles (or bends)	0-20
		18	8. Bank Stability (LB & RB)	0-20		8. Bank Stability (LB & RB)	0-20		8. Bank Stability (LB & RB)	0-20		8. Bank Stability (LB & RB)	0-20
		14	9. Vegetative Protection (LB & RB)	0-20		9. Vegetative Protection (LB & RB)	0-20		9. Vegetative Protection (LB & RB)	0-20		9. Vegetative Protection (LB & RB)	0-20
10. Riparian Vegetative Zone Width (LB & RB)		18	10. Riparian Vegetative Zone Width (LB & RB)	0-20		10. Riparian Vegetative Zone Width (LB & RB)	0-20		10. Riparian Vegetative Zone Width (LB & RB)	0-20		10. Riparian Vegetative Zone Width (LB & RB)	0-20
		87	Total RBP Score	Poor 0		Total RBP Score	Poor	0	Total RBP Score	Poor	0	Total RBP Score	Poor 0
Sub-Total CHEMICAL INDICATOR (Applies to Intermittent and		725	Sub-Total CHEMICAL INDICATOR (Applies to Intermittent	and Perennial Streams)		Sub-Total CHEMICAL INDICATOR (Applies to Intermitte	ent and Perennial	0 Streams)	Sub-Total CHEMICAL INDICATOR (Applies to Intermitte	ent and Perennial S	0 Streams)	Sub-Total CHEMICAL INDICATOR (Applies to Intermitten	t and Perennial Streams)
111				,				,					•
WVDEP Water Quality Indicators (General) Specific Conductivity			WVDEP Water Quality Indicators (General) Specific Conductivity			WVDEP Water Quality Indicators (General Specific Conductivity	al)		WVDEP Water Quality Indicators (General Specific Conductivity	al)		WVDEP Water Quality Indicators (General) Specific Conductivity	
			Specific conductivity			opecine conductivity			opecinic conductivity			Specific Conductivity	
100-199 - 85 points	0-90			0-90			0-90			0-90			0-90
рН	0-1		pH	0-1		pH	0-		рн	0-1		pH	0-1
5.6-5.9 = 45 points	0-80			5-90			5-90			5-90			5-90
DO		0.11	DO			DO			DO			DO	
1	10-30			10-30			10-30			10-30			10-30
Sub-Total			Sub-Total	0		Sub-Total		0	Sub-Total		0	Sub-Total	0
BIOLOGICAL INDICATOR (Applies to Intermittent	and Perennial Streams	s)	BIOLOGICAL INDICATOR (Applies to Intermitte	nt and Perennial Streams)		BIOLOGICAL INDICATOR (Applies to Intere	mittent and Pere	nnial Streams)	BIOLOGICAL INDICATOR (Applies to Inter	mittent and Pereni	nial Streams)	BIOLOGICAL INDICATOR (Applies to Intermi	ittent and Perennial Streams)
WV Stream Condition Index (WVSCI)			WV Stream Condition Index (WVSCI)			WV Stream Condition Index (WVSCI)			WV Stream Condition Index (WVSCI)			WV Stream Condition Index (WVSCI)	
0	0-100 0-1			0-100 0-1			0-100 0-	1		0-100 0-1			0-100 0-1
0			Cub Tatal			Cub Tatal			Cub Tatal			Cub Tatal	
Sub-Total		0	Sub-Total	0		Sub-Total		0	Sub-Total		0	Sub-Total	0
PART II - Index and Unit S	Score		PART II - Index and t	Init Score		PART II - Index an	d Unit Score		PART II - Index and	Unit Score		PART II - Index and Ui	nit Score
Index L	inear Feet Unit	Score	Index	Linear Feet Unit Score		Index	Linear Fee	t Unit Score	Index	Linear Feet	Unit Score	Index	Linear Feet Unit Score
0.523	86 44.970	083333	0	0 0		0	0	0	0	0	0	0	0 0

			High-0			ter Strea et and C	-	-	a		
ssess	ment Team:	VM A.I		i ieiu i	Jala Sile	et and C	aicuiaio		M Northing:	37 063464	
	oject Name:		allev Pipelin	<u></u> е			<u>.</u>		_	-79.878281	
	•	Franklin Co						•	npling Date:		
S	AR Number:	S-YZ5	Reach	Length (ft):	60	Stream Ty	rpe: Ephe	emeral Stream			_
	Top Strata:	Sh	rub/Herb Str	rata	(determined	d from perce					
Site	and Timing:	Project Site				•	Before Proje	ct			•
mple	e Variables	1-4 in strear	n channel								
1	V _{CCANOPY}	Average pe equidistant	rcent cover points along st one value	the stream. between 0	Measure o and 19 to trig	d sapling car nly if tree/sa gger Top Str	pling cover i			• •	Not Used <20%
	0			1 11 11 11 11 1							
2	V_{EMBED}	along the st and area su following ta the bed is c	ream. Sele Irrounding the ble. If the be omposed of	ct a particle ne particle th ed is an artifi bedrock, us	from the bed at is covered icial surface, se a rating so	Measure a d. Before mo d by fine sec , or compose core of 5. ulder particle	oving it, dete liment, and e ed of fine se	ermine the pe enter the rati diments, use	ercentage of ng according e a rating sco	the surface g to the ore of 1. If	1.8
		1983)					(1.00041104				
		Rating 5	Rating Des		overed, surr	ounded, or b	ouried by fine	e sediment (or bedrock)		
		4	5 to 25 perc	ent of surfa	ce covered,	surrounded,	or buried by	/ fine sedime	ent		
		3				l, surrounded l, surrounded		•			
		1				rounded, or		•		surface)	
	List the ration	ngs at each	point below:								
	4	3	1	2	1	1	2	2	1	1	
	2	2	2	1	1	2	2	3	2	2	
	3	1	1	2	1	1	2	1	2	2	
3	V _{SUBSTRATE} Median stream channel substrate particle size. Measure at no fewer than 30 roughly equidistant points along the stream; use the same points and particles as used in V _{EMBED} . Enter particle size in inches to the nearest 0.1 inch at each point below (bedrock should be counted as 99 in, asphalt or concrete as 0.0 in, sand or finer particles as 0.08 in):								2.05 in		
	2.50	2.60	2.50	2.40	2.80	2.90	2.00	2.50	2.20	2.00	
	1.80	2.30	2.00	1.10	0.08	4.20	0.08	0.08	2.60	0.08	
	2.70	2.10	2.00	0.50	0.60	2.60	2.30	0.08	0.70	0.40	
4	V_{BERO}	-	ıl percentage	e will be cald	culated If bo	Enter the tota th banks are	e eroded, to	tal erosion fo	or the stream		0 %
			Left Bank:		ft		Right Bank:		ft		
mple 5	V _{LWD}	Number of	down woody	stems (at le	east 4 inches	s in diameter	r and 36 inch	nes in length) per 100 fee	et of stream	0.0
			ım will be ca			of downed wo			0		
6	V_{TDBH}	-		-		tree/sapling	cover is at l	east 20%).	Trees are a	t least 4	Not Use
		,	measureme		ree DBHs in dual trees (a	inches. at least 4 in)	within the bu	uffer on eacl	n side of the		1101 000
			Left Side					Right Side			
	0					0					
7	V _{SNAG}		• ,		, .	er 100 feet o		nter number	of snags or	each side	0.0
				·					•		
8	Varr	Number of	Left Side:		ody stems i	ıp to 4 inche	Right Side:		0 ream (meas)	ure only if	
U	V_{SSD}	tree cover is		nter number		and shrubs o					100.0
		_	Left Side:	2	25		Right Side:	3	35		

9	V _{SRICH}	in the talles	t stratum. C	heck all exc	•	sive species	reach. Che s present in a	•	•	•	0.00
-			p 1 = 1.0	iii be calcula	atou nom tile	oo uala.		Group	2 (-1.0)		
П	Acer rubrur		<u></u>	Magnolia tri	ipetala		Ailanthus al		_ ()	Lonicera ja	oonica
	Acer sacch			Nyssa sylva	•		Albizia julibr			Lonicera tat	
	Aesculus fla			Oxydendrum			Alliaria petio			Lotus cornic	
	Asimina trile			Prunus ser			-			Lythrum sai	
							Alternanthe philoxeroide			-	
	Betula alleg			Quercus ali			•		V	Microstegium	
	Betula lenta				Paulownia t						
	Carya alba			Quercus im			Cerastium f			Polygonum c	
	Carya glabi			Quercus pr			Coronilla va			Pueraria mo	
	Carya ovali	S		Quercus ru	bra		Elaeagnus ur	nbellata		Rosa multifi	lora
	Carya ovat	э		Quercus ve	elutina		Lespedeza	bicolor		Sorghum ha	alepense
	Cornus flor	ida		Sassafras a	albidum		Lespedeza	cuneata		Verbena bra	asiliensis
	Fagus gran	difolia		Tilia americ	ana		Ligustrum ob	tusifolium			
	Fraxinus ar	nericana		Tsuga cana	adensis		Ligustrum s	inense			
V	Liriodendron	tulipifera		Ulmus ame	ricana						
	Magnolia a	cuminata									
			0 : :	2 4							
		1	Species in (roup 1				1	Species in	Group 2	
Sample	o Variables	10_11 within	at loast 8 s	ubplote (40	" v 40" or 1	1m v 1m) ir	n the riparian	/buffor zon	o within 25	foot from o	ach hank
-						-	of the stream		e within 25	ieet iroin e	acii balik.
10	V _{DETRITUS}	Average pe	rcent cover	of leaves, st	icks, or othe	r organic m	aterial. Woo	dy debris <4	" diameter a	and <36"	47.00.0/
		long are inc	lude. Enter	the percent	cover of the	detrital laye	er at each sub	oplot.			17.00 %
				Side	1		Right				
		20	20	10	25	16	5	20	20		
11	\/	Average po	reentage co	vor of borba	coous voget	tation (mage	sure only if tre	o cover is c	(20%) Do t	ot include	
''	V_{HERB}						ay be several				00.04
		percentage	s up through	200% are a	accepted. E	nter the per	cent cover of	ground veg	etation at ea	ach subplot.	83 %
			1 -4	Side			Dialet	Cida		1	
		80	80 80	90	75	85	Right 95	80	80		
		00	00	90	73	65	93	80	00		
Commit	- Variable 4	0 i dhi na dha									
Sample	e Variable 1										
12	V_{WLUSE}	Weighted A	verage of R	unoff Score	for watershe	ed:					0.41
										<u> </u>	ъ .
			Land	Use (Choos	e From Dro	p List)			Runoff	% in Catch-	Running Percent
						•			Score	ment	(not >100)
	Forest and n	ative range (<	50% ground o	cover)				•	0.5	22	22
	Forest and n	ative range (>	75% ground o	cover)				~	1	30	52
		reas (parking						•	0	48	100
	-								0	40	100
	Newly grade	d areas (bare	soil, no veget	ation or paver	ment)			_	0	0	
	Open space	(pasture, lawn	s, parks, etc.),	grass cover <	50%			•	0.1	0	
	Open space	(pasture, lawn	s, parks, etc.),	grass cover >	75%			•	0.3	0	
	-							_			
								•			
	5	S-YZ5					Not	es:			
V	ariable	Value	VSI	Land Cov	er Analysis	was comp	pleted using	the 2019	National La	and Cover	Database
		Not Used,		,			imagery an			•	
	CANOPY	<20%	Not Used				sed off of fie			•	umbar
VE	MBED	1.8	0.38	reicenta	aes III carc	ınnent val	ues have be	sen rounde	a wine ne	zarest IUII r	iuiiibel
Vs											
	UBSTRATE	2.05 in	1.00								
* R											
	ERO	0 %	1.00								
V _L	ERO										
V _L	ERO	0 %	1.00								
V _L	ERO WD DBH	0 % 0.0 Not Used	1.00 0.00 Not Used								
V _L V _T V _S	ERO WD DBH NAG	0 % 0.0 Not Used 0.0	1.00 0.00 Not Used 0.10								
V _L	ERO WD DBH NAG	0 % 0.0 Not Used	1.00 0.00 Not Used								
V _L V _T V _S	ERO WD DBH NAG	0 % 0.0 Not Used 0.0	1.00 0.00 Not Used 0.10								
V _L V _T V _S V _S	ERO WD DBH NAG SD	0 % 0.0 Not Used 0.0 100.0	1.00 0.00 Not Used 0.10 1.00								
V _L V _T V _S V _S V _D	ERO WD DBH NAG SD RICH ETRITUS	0 % 0.0 Not Used 0.0 100.0 0.00	1.00 0.00 Not Used 0.10 1.00 0.00								
V _L ' V _T V _S V _S V _S V _D V _H	ERO WD DBH NAG SD	0 % 0.0 Not Used 0.0 100.0 0.00 17.0 %	1.00 0.00 Not Used 0.10 1.00 0.00 0.21								

Ver. 10-20-17

FCI Calculator for the High-Gradient Headwater Streams in Appalachia

To ensure accurate calculations, the <u>UPPERMOST STRATUM</u> of the plant community is determined based on the calculated value for V_{CCANOPY} (≥20% cover is required for tree/sapling strata). Go to the SAR Data Entry tab and enter site characteristics and data in the yellow cells. For information on determining how to split a project into SARs, see Chapter 5 of the Operational Draft Regional Guidebook for the Functional Assessment of High-Gradient Headwater Streams and Low-Gradient Perennial Streams in Appalachia (Environmental Laboratory U.S. Army Corps of Engineers 2017).

Project Name: Mountain Valley Pipeline

Location: Franklin County

Sampling Date: 8/28/2021 Project Site Before Project

Subclass for this SAR:

Ephemeral Stream

Uppermost stratum present at this SAR: SAR number: S-YZ5

Shrub/Herb Strata

Functional Results Summary:

Enter Results in Section A of the Mitigation Sufficiency Calculator


Function	Functional Capacity Index
Hydrology	0.31
Biogeochemical Cycling	0.30
Habitat	0.24

Variable Measure and Subindex Summary:

Variable	Name	Average Measure	Subindex
V _{CCANOPY}	Percent canpoy over channel.	Not Used, <20%	Not Used
V_{EMBED}	Average embeddedness of channel.	1.77	0.38
V _{SUBSTRATE}	Median stream channel substrate particle size.	2.05	1.00
V_{BERO}	Total percent of eroded stream channel bank.	0.00	1.00
V_{LWD}	Number of down woody stems per 100 feet of stream.	0.00	0.00
V _{TDBH}	Average dbh of trees.	Not Used	Not Used
V _{SNAG}	Number of snags per 100 feet of stream.	0.00	0.10
V _{SSD}	Number of saplings and shrubs per 100 feet of stream.	100.00	1.00
V _{SRICH}	Riparian vegetation species richness.	0.00	0.00
V _{DETRITUS}	Average percent cover of leaves, sticks, etc.	17.00	0.21
V _{HERB}	Average percent cover of herbaceous vegetation.	83.13	1.00
V _{WLUSE}	Weighted Average of Runoff Score for Catchment.	0.41	0.43

PHYSICAL CHARACTERIZATION/WATER QUALITY FIELD DATA SHEET (FRONT)

STREAM NAME	LOCATION				
STATION # RIVERMILE	STREAM CLASS				
LAT LONG	RIVER BASIN				
STORET#	AGENCY				
INVESTIGATORS					
FORM COMPLETED BY	DATE	REASON FOR SURVEY			

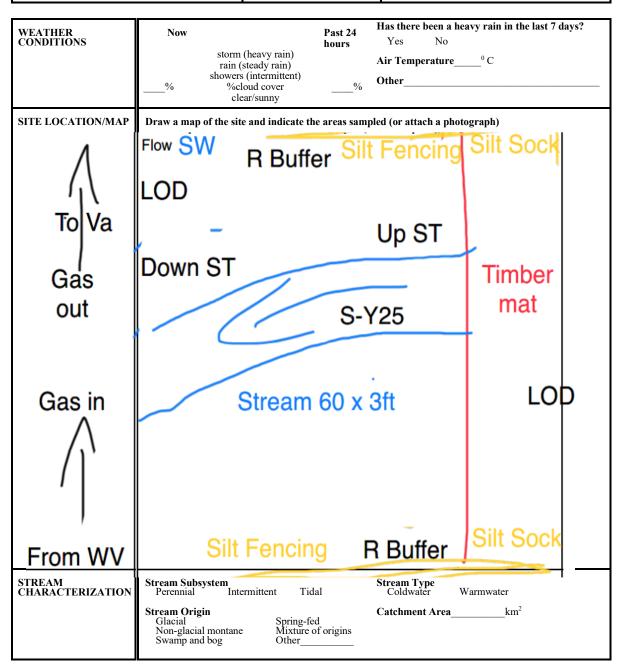

PHYSICAL CHARACTERIZATION/WATER QUALITY FIELD DATA SHEET (BACK)

WATERS FEATURI		Fores Field Agric	Pasture Industria	rcial	No evidence Sor Obvious sources Local Watershed Erosi None Moderate	ne potential sources
RIPARIA VEGETA (18 meter	ΓΙΟΝ	Trees	e the dominant type and SI nt species present	hrubs	Grasses He	rbaceous
INSTREA FEATURI		Estimat Samplin Area in Estimat	ed Stream Depthm	m m² km² m	Canopy Cover Partly open Part High Water Mark Proportion of Reach R Morphology Types Riffle Pool Channelized Yes Dam Present Yes	Run%
LARGE V DEBRIS	VOODY		of LWDm	n ² /km ² (LWD /	reach area)	
AQUATIO VEGETA		Domina			minant species present nt Rooted floating	Ü
WATER (QUALITY	Specific Dissolve pH Turbidi	cature0 C Conductance ed Oxygen ty trument Used		Water Odors Normal/None Sewage Petroleum Fishy Water Surface Oils Slick Sheen None Other Turbidity (if not measu Clear ☐ Slightly tu Opaque Stained	Chemical Other Globs Flecks
SEDIMENT/ SUBSTRATE Odors Normal Sewage Chemical Anaerobic Other Oils Absent Slight Moderal				are the undersides blac	h are not deeply embedded,	
INC	ORGANIC SUBS		COMPONENTS		ORGANIC SUBSTRATE C	
Substrate Type	Diamete		% Composition in Sampling Reach	Substrate Type	Characteristic	% Composition in Sampling Area
Bedrock				Detritus	sticks, wood, coarse plant materials (CPOM)	
Boulder	> 256 mm (10")				materials (CI OIVI)	
Cobble	64-256 mm (2.5	"-10")		Muck-Mud	black, very fine organic (FPOM)	
Gravel	2-64 mm (0.1"-2	2.5")			(11 0101)	

Sand

Silt

Clay

0.06-2mm (gritty)

< 0.004 mm (slick)

0.004-0.06 mm

grey, shell fragments

Marl

HABITAT ASSESSMENT FIELD DATA SHEET - HG - USE ON ALL STREAMS (FRONT)

STREAM NAME	LOCATION		
STATION # RIVERMILE	STREAM CLASS		
LAT LONG	RIVER BASIN		
STORET#	AGENCY		
INVESTIGATORS			
FORM COMPLETED BY	DATE AM PM	REASON FOR SURVEY	

	Habitat		Condition	ı Category	
	Parameter	Optimal	Suboptimal	Marginal	Poor
	1. Epifaunal Substrate/ Available Cover	Greater than 70% of substrate favorable for epifaunal colonization and fish cover; mix of snags, submerged logs, undercut banks, cobble or other stable habitat and at stage to allow full colonization potential (i.e., logs/snags that are not new fall and not transient).	40-70% mix of stable habitat; well-suited for full colonization potential; adequate habitat for maintenance of populations; presence of additional substrate in the form of newfall, but not yet prepared for colonization (may rate at high end of scale).	20-40% mix of stable habitat; habitat availability less than desirable; substrate frequently disturbed or removed.	Less than 20% stable habitat; lack of habitat is obvious; substrate unstable or lacking.
	SCORE	20 19 18 17 16	15 14 13 12 11	10 9 8 7 6	5 4 3 2 1 0
n sampling reach	2. Embeddedness	Gravel, cobble, and boulder particles are 0-25% surrounded by fine sediment. Layering of cobble provides diversity of niche space.	Gravel, cobble, and boulder particles are 25- 50% surrounded by fine sediment.	Gravel, cobble, and boulder particles are 50- 75% surrounded by fine sediment.	Gravel, cobble, and boulder particles are more than 75% surrounded by fine sediment.
ted in	SCORE	20 19 18 17 16	15 14 13 12 11	10 9 8 7 6	5 4 3 2 1 0
Parameters to be evaluated in sampling reach	3. Velocity/Depth Regime	All four velocity/depth regimes present (slow-deep, slow-shallow, fast-deep, fast-shallow). (Slow is < 0.3 m/s, deep is > 0.5 m.)	Only 3 of the 4 regimes present (if fast-shallow is missing, score lower than if missing other regimes).	Only 2 of the 4 habitat regimes present (if fast-shallow or slow-shallow are missing, score low).	Dominated by 1 velocity/depth regime (usually slow-deep).
ıram	SCORE	20 19 18 17 16	15 14 13 12 11	10 9 8 7 6	5 4 3 2 1 0
Ps	4. Sediment Deposition	Little or no enlargement of islands or point bars and less than 5% of the bottom affected by sediment deposition.	Some new increase in bar formation, mostly from gravel, sand or fine sediment; 5-30% of the bottom affected; slight deposition in pools.	Moderate deposition of new gravel, sand or fine sediment on old and new bars; 30-50% of the bottom affected; sediment deposits at obstructions, constrictions, and bends; moderate deposition of pools prevalent.	Heavy deposits of fine material, increased bar development; more than 50% of the bottom changing frequently; pools almost absent due to substantial sediment deposition.
	SCORE	20 19 18 17 16	15 14 13 12 11	10 9 8 7 6	5 4 3 2 1 0
	5. Channel Flow Status	Water reaches base of both lower banks, and minimal amount of channel substrate is exposed.	Water fills >75% of the available channel; or <25% of channel substrate is exposed.	Water fills 25-75% of the available channel, and/or riffle substrates are mostly exposed.	Very little water in channel and mostly present as standing pools.
	SCORE	20 19 18 17 16	15 14 13 12 11	10 9 8 7 6	5 4 3 2 1 0

HABITAT ASSESSMENT FIELD DATA SHEET—HIGH GRADIENT STREAMS (BACK)

	Habitat		Conditi	Condition Category						
	Parameter	Optimal	Suboptimal	Marginal	Poor					
	6. Channel Alteration	Channelization or dredging absent or minimal; stream with normal pattern.	Some channelization present, usually in areas of bridge abutments; evidence of past channelization, i.e., dredging, (greater than past 20 yr) may be present, but recent channelization is not present.	Channelization may be extensive; embankments or shoring structures present on both banks; and 40 to 80% of stream reach channelized and disrupted.	Banks shored with gabion or cement; over 80% of the stream reach channelized and disrupted. Instream habitat greatly altered or removed entirely.					
	SCORE	20 19 18 17 16	15 14 13 12 11	10 9 8 7 6	5 4 3 2 1 0					
oling reach	7. Frequency of Riffles (or bends)	Occurrence of riffles relatively frequent; ratio of distance between riffles divided by width of the stream <7:1 (generally 5 to 7); variety of habitat is key. In streams where riffles are continuous, placement of boulders or other large, natural obstruction is important.	Occurrence of riffles infrequent; distance between riffles divided by the width of the stream is between 7 to 15.	Occasional riffle or bend; bottom contours provide some habitat; distance between riffles divided by the width of the stream is between 15 to 25.	Generally all flat water or shallow riffles; poor habitat; distance between riffles divided by the width of the stream is a ratio of >25.					
sampl	SCORE	20 19 18 17 16	15 14 13 12 11	10 9 8 7 6	5 4 3 2 1 0					
Parameters to be evaluated broader than sampling reach	8. Bank Stability (score each bank) Note: determine left or right side by facing downstream.	Banks stable; evidence of erosion or bank failure absent or minimal; little potential for future problems. <5% of bank affected.	Moderately stable; infrequent, small areas of erosion mostly healed over. 5-30% of bank in reach has areas of erosion	areas of erosion; high erosion potential during	Unstable; many eroded areas; "raw" areas frequent along straight sections and bends; obvious bank sloughing; 60-100% of bank has erosional scars.					
e eva	SCORE (LB)	Left Bank 10 9	8 7 6	5 4 3	2 1 0					
to be	SCORE (RB)	Right Bank 10 9	8 7 6	5 4 3	2 1 0					
Parameters	9. Vegetative Protection (score each bank)	More than 90% of the streambank surfaces and immediate riparian zone covered by native vegetation, including trees, understory shrubs, or nonwoody macrophytes; vegetative disruption through grazing or mowing minimal or not evident; almost all plants allowed to grow naturally.	70-90% of the streambank surfaces covered by native vegetation, but one class of plants is not well-represented; disruption evident but not affecting full plant growth potentia to any great extent; more than one-half of the potential plant stubble height remaining.	50-70% of the streambank surfaces covered by vegetation; disruption obvious; patches of bare soil or closely cropped vegetation common; less than one-half of the potential plant stubble height remaining.	Less than 50% of the streambank surfaces covered by vegetation; disruption of streambank vegetation is very high; vegetation has been removed to 5 centimeters or less in average stubble height.					
	SCORE (LB)	Left Bank 10 9	8 7 6	5 4 3	2 1 0					
	SCORE (RB)	Right Bank 10 9	8 7 6	5 4 3	2 1 0					
	10. Riparian Vegetative Zone Width (score each bank riparian zone)	Width of riparian zone >18 meters; human activities (i.e., parking lots, roadbeds, clear-cuts, lawns, or crops) have not impacted zone.	Width of riparian zone 12-18 meters; human activities have impacted zone only minimally.	Width of riparian zone 6- 12 meters; human activities have impacted zone a great deal.	Width of riparian zone <6 meters: little or no riparian vegetation due to human activities.					
	SCORE (LB)	Left Bank 10 9	8 7 6	5 4 3	2 1 0					
1	SCORE (RB)	Right Bank 10 9	8 7 6	5 4 3	2 1 0					

Total	Caama	
i otai	Score	

BENTHIC MACROINVERTEBRATE FIELD DATA SHEET

STREAM NAME	LOCATION				
STATION # RIVERMILE	STREAM CLASS				
LAT LONG	RIVER BASIN				
STORET#	AGENCY				
INVESTIGATORS		LOT NUMBER			
FORM COMPLETED BY	DATETIME	REASON FOR SURVEY			
HADITAT TYPES Indicate the percentage of	and habitat type present				

HABITAT TYPES	Indicate the percentage of each habitat type present Cobble% Snags% Vegetated Banks% Sand% Submerged Macrophytes% Other ()%
SAMPLE COLLECTION	Gear used D-frame kick-net Other How were the samples collected? wading from bank from boat
	Indicate the number of jabs/kicks taken in each habitat type. Cobble Snags Vegetated Banks Sand Submerged Macrophytes Other ()
GENERAL COMMENTS	

QUALITATIVE LISTING OF AQUATIC BIOTA

Indicate estimated abundance: 0 = Absent/Not Observed, 1 = Rare, 2 = Common, 3 = Abundant, 4 = Dominant

Periphyton	0	1	2	3	4	Slimes	0	1	2	3	4
Filamentous Algae	0	1	2	3	4	Macroinvertebrates	0	1	2	3	4
Macrophytes	0	1	2	3	4	Fish	0	1	2	3	4

FIELD OBSERVATIONS OF MACROBENTHOS

Indicate estimated abundance: 0 = Absent/Not Observed, 1 = Rare (1-3 organisms), 2 = Common (3-9 organisms), 3 = Abundant (>10 organisms), 4 = Dominant (>50 organisms)

Porifera	0	1	2	3	4	Anisoptera	0	1	2	3	4	Chironomidae	0	1	2	3	4
Hydrozoa	0	1	2	3	4	Zygoptera	0	1	2	3	4	Ephemeroptera	0	1	2	3	4
Platyhelminthes	0	1	2	3	4	Hemiptera	0	1	2	3	4	Trichoptera	0	1	2	3	4
Turbellaria	0	1	2	3	4	Coleoptera	0	1	2	3	4	Other	0	1	2	3	4
Hirudinea	0	1	2	3	4	Lepidoptera	0	1	2	3	4						
Oligochaeta	0	1	2	3	4	Sialidae	0	1	2	3	4						
Isopoda	0	1	2	3	4	Corydalidae	0	1	2	3	4						
Amphipoda	0	1	2	3	4	Tipulidae	0	1	2	3	4						
Decapoda	0	1	2	3	4	Empididae	0	1	2	3	4						
Gastropoda	0	1	2	3	4	Simuliidae	0	1	2	3	4						
Bivalvia	0	1	2	3	4	Tabinidae	0	1	2	3	4						
						Culcidae	0	1	2	3	4						

WOLMAN PEBBLE COUNT FORM

County: Franklin County Stream ID: S-YZ5

Stream Name: UNT to Blackwater River

HUC Code: 03010101 Basin: Upper Roanoke

Survey Date: 8/28/2021 Surveyors: VM, AJ Type: Representative

	D + DETCH E		LE COUNT		PD + 3 //	T. 0/	0/ G
Inches	PARTICLE	Millimeters		Particle Count	Total #	Item %	% Cur
	Silt/Clay	< .062	S/C	*	10	10.00	10.00
	Very Fine	.062125		•		0.00	10.00
	Fine	.12525	1	•		0.00	10.00
	Medium	.255	SAND	•	3	3.00	13.00
	Coarse	.50-1.0	1	*	7	7.00	20.00
.0408	Very Coarse	1.0-2	1	*		0.00	20.00
.0816	Very Fine	2 -4		+		0.00	20.00
.1622	Fine	4 -5.7	1	+		0.00	20.00
.2231	Fine	5.7 - 8	1	+		0.00	20.00
.3144	Medium	8 -11.3	1	•		0.00	20.00
.4463	Medium	11.3 - 16	GRAVEL	*		0.00	20.00
.6389	Coarse	16 -22.6		*	10	10.00	30.00
.89 - 1.26	Coarse	22.6 - 32	1	*	5	5.00	35.00
1.26 - 1.77	Vry Coarse	32 - 45		*	10	10.00	45.00
1.77 -2.5	Vry Coarse	45 - 64		*	15	15.00	60.00
2.5 - 3.5	Small	64 - 90		^	40	40.00	100.0
3.5 - 5.0	Small	90 - 128	1	+		0.00	100.0
5.0 - 7.1	Large	128 - 180	COBBLE	^		0.00	100.0
7.1 - 10.1	Large	180 - 256	1	*		0.00	100.0
10.1 - 14.3	Small	256 - 362		*		0.00	100.0
14.3 - 20	Small	362 - 512	1	*		0.00	100.0
20 - 40	Medium	512 - 1024	BOULDER	^		0.00	100.0
40 - 80	Large	1024 -2048	1	*		0.00	100.0
80 - 160	Vry Large	2048 -4096	1	^		0.00	100.0
	Bedrock		BDRK	^		0.00	100.0
			1	Totals:	100		

RIVERMORPH PARTICLE SUMMARY

River Name: UNT to Blackwater River Reach Name: S-YZ5 Sample Name: Representative 08/28/2021

Size (mm)	TOT #	ITEM %	CUM %
0 - 0.062 0.062 - 0.125 0.125 - 0.25 0.25 - 0.50 0.50 - 1.0 1.0 - 2.0 2.0 - 4.0 4.0 - 5.7 5.7 - 8.0 8.0 - 11.3 11.3 - 16.0 16.0 - 22.6 22.6 - 32.0 32 - 45 45 - 64 64 - 90 90 - 128 128 - 180 180 - 256 256 - 362 362 - 512 512 - 1024 1024 - 2048 Bedrock	10 0 0 0 3 7 0 0 0 0 0 0 0 10 5 10 15 40 0 0 0 0 0	10.00 0.00 0.00 3.00 7.00 0.00 0.00 0.00 0.00 0.00 10.00 10.00 15.00 40.00 0.00 0.00 0.00 0.00 0.00	10.00 10.00 10.00 13.00 20.00 20.00 20.00 20.00 20.00 20.00 30.00 35.00 45.00 60.00 100.00 100.00 100.00 100.00 100.00 100.00 100.00
D16 (mm) D35 (mm) D50 (mm) D84 (mm) D95 (mm) D100 (mm) Silt/Clay (%) Sand (%) Gravel (%) Cobble (%) Boulder (%) Bedrock (%)	0.71 32 51.33 79.6 86.75 90 10 10 40 40		

Total Particles = 100.

Ephemeral Stream Assessment Form (Form 1a)

Unified Stream Methodology for use in Virginia

	For use in ephemeral streams								
Project #	Project Name		Locality	Cowardin Class.	HUC	Date	SAR#	Impact Length	Impact Factor
22865.06	Mountain Valley Pipeline Valley Pipeline, I	ranklin Coun	R6	03010101	8/28/21	S-YZ5	86	1	
Name	e(s) of Evaluator(s)	Stream Nam	e and Informa	tion	SAR Length				
	VM, AJ	kwater		86					

2. RIPARIAN BUFFERS: Assess both bank's 100 foot riparian areas along the entire SAR. (rough measurements of length & width may be acceptable)

		Cor	ditional Cate	gory				NOTES>>	
	Optimal	Subo	ptimal	Marg	ginal	Po	oor		
Riparian Buffers	Tree stratum (dbh > 3 inches) present, with > 60% tree canopy cover and an non-maintained understory. Wetlands areas.	High Suboptimal: Riparian areas with tree stratum (dh > 3 inches) present, with 30% to 60% tree canopy cover and containing both herbaceous and shrub layers or a non-maintained understory.	Riparian areas with tree stratum (dbh > 3 inches) present, with >30% tree canopy cover and	dense herbaceous vegetation with either a shrub layer or a tree layer (dbh	Non-maintained, dense herbaceous vegetation, riparian areas lacking shrub and tree stratum, hay production, ponds, open water. If present, tree	High Poor: Lawns, mowed, and maintained areas, nurseries; no-till cropland; actively grazed pasture, sparsely vegetated non-maintained area, recently seeded and stabilized, or other comparable condition.	Low Poor: Impervious surfaces, mine spoil lands, denuded surfaces, row crops, active feed lots, trails, or other comparable conditions.		
		High	Low	High	Low	High	Low		
Condition	1.5	1.2	1.1	0.85	0.75	0.6	0.5		
Scores				0.00	••	0.0	0.0		
. Delineate ripa	arian areas along each stream bank uare footage for each by measuring			lition Scores using	the descriptors.	Ensure t	the sums		
. Delineate ripa	<u> </u>	or estimating leng	th and width. Cal	lition Scores using	the descriptors.	Ensure t	the sums		
Delineate ripal. Determine so	uare footage for each by measuring	or estimating leng	th and width. Cal	lition Scores using	the descriptors.	Ensure t	the sums Riparian		
. Delineate ripa	uare footage for each by measuring	or estimating leng	th and width. Cal	lition Scores using	the descriptors.	Ensure t	the sums Riparian		
Delineate ripal. Determine so	uare footage for each by measuring Riparian Area and Score for each rip Riparian Area> 100%	or estimating leng	th and width. Cal	lition Scores using	the descriptors.	Ensure t	the sums Riparian	Cl= (Sum % RA * Sc	pores*0.01)/2
Delineate ripal. Determine so	uare footage for each by measuring Riparian Area and Score for each rip Riparian Area> 100%	or estimating leng	th and width. Cal	lition Scores using	the descriptors.	Ensure t	the sums Riparian	CI= (Sum % RA * Sc Rt Bank CI >	cores*0.01)/2 0.85

IOTT. The Classed BCI should be assembled to 2 decimal places. The CD should be assembled to a whole sumbles

THE REACH CONDITION INDEX (RCI) >> RCI= (Riparian CI)/2


COMPENSATION REQUIREMENT (CR) >> 37


CR = RCI X LF X IF

INSERT PHOTOS:




CAPTION. Assessment is limited to areas within the temporary ROW.

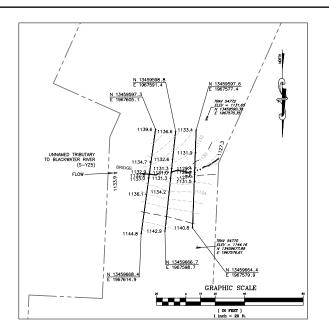

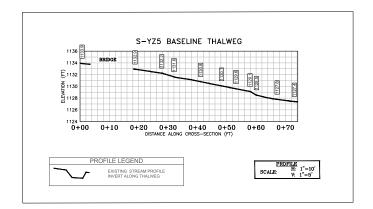


CL STAKEOUT POINTS: S-YZ5 CROSS SECTION B (PIPE CL)									
	PRE	-CROSSING		POST-CI	ROSSING				
PT. LOC.	NORTHING	EASTING	ELEV	VERT. DIFF.	HORZ. DIFF.				
TS-L	13459617.72	1967593.57	1132.63						
BS-L	13459623.96	1967594.02	1131.25						
THW	13459626.91	1967594.37	1131.04						
BS-R	13459630.59	1967594.91	1131.27						
TS-R	13459639.91	1967595.77	1134.17						

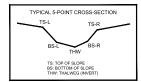

SURVEY NOTES:

- 1. This map has been oriented to NAD 1983 UTM ZONE 17N, and vertically to The North American Vertical Datum of 1988 (NAVD 88), using a Real Time Network (RTN) GPS. Field locations were completed on December 18, 2019.
- 2. Monumentation, including traverse stations and fly points, shown on this drawing should be used to orient any future boundary, topographic, or location survey.
- 3. Easement lines shown on plan view were provided by Mountain Valley Pipeline (MVP).
- 4. WSSI Contour Interval = 2.0'. Contours within the channel were interpolated using stream channel breaklines (i.e. top of slopes, toe of slopes, thalweg) and cross-sectional points. Contours outside the channel were interpolated using cross-sectional spot shots.
- 5. All section views shown are left to right facing downstream.
- 6. Cross-section B shot at location of pipe centerline (based on best professional judgement).

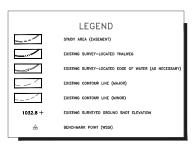





TO THE WEST ON 12/18/201



PENDING CROSSING

PHOTO TAKEN LOOKING

PENDING CROSSING






S-YZ5 - UNT to Blackwater River (MP 265.5) Franklin County, Virginia


Crossing 5

	ž						a
Horizontal Datum: NAB 1983 UTN 20NE 17N							
Vertical Datum: NAVD 88							
	dary a	nd 7	Горо	So	urce	:	
MVP							
WSSI	2' C.I.	Top	10				


SI 2' C.I. Topo								
sign	Draft	Approved						
JC	JSF	NAS						
Sheet #								

1 of 1

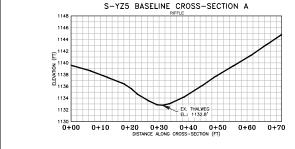

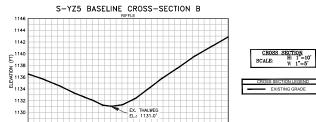

0+20 0+30 0+40 0+50 0+60
DISTANCE ALONG CROSS-SECTION (FT)

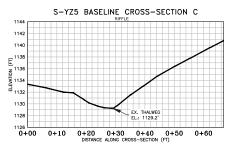

0+00

0+10

NOTE: ALL SECTIONS VIEWS SHOWN FACING LEFT TO RIGHT FACING DOWNSTREAM.